


Electrical Test Program – Test

Preparation for Test:

1. Review section 0,
2. Review C/1, 20, 21, 31, 32.

⇒		Test scope	Test connection	Test condition	Nominal value	Possible cause/Remedy
1.0	B1124	Remote trunk release		Trunk lid closed. Trunk lid not locked with mechanical key. Remote trunk release switch (N72s15): Press switch:	Trunk lid opens. LED in switch illuminated.	32 PSE/RTR ⇒ 1.0, See AD80.20-P-8000-10B, PSE (A37), Lower control field control module (N72), Mechanical fault in trunk lid lock, 23 PSE/RTR ⇒ 3.0
2.0		Trunk release switch (S15/1)		Trunk lid closed. Trunk lid not locked with mechanical key. Unlock trunk lid by pressing lock button on trunk release switch.	Trunk lid opens. LED in switch illuminated.	See AD80.20-P-6000-15B, 32 PSE/RTR ⇒ 1.0, See AD80.20-P-8000-10B, PSE (A37), Mechanical fault in trunk lid lock, 23 PSE/RTR ⇒ 3.0
3.0		Trunk lamp switch (S17/8)		Trunk lid unlocked via remote trunk release switch (N72s15).	LED in switch (N72s15) illuminated.	Wiring, See AD80.20-P-6000-14B, S17/8, Lower control field control module (N72), PSE (A37).