

**Diagnosis – Complaint Related Diagnostic Chart**

Complaint/Problem	Possible cause	Test step/Remedy <sup>1)</sup>
Left and right Xenon low beam headlamps (E1e8 and E2e8) do not function.	Fuses, Wiring, Illumination control module (N7-1), models 208, 210 Fuse and relay box (F1), model 202	Models 208, 210 23 ⇒ 1.0, 23 ⇒ 2.0  Model 202 23 ⇒ 3.0, 23 ⇒ 4.0
Left Xenon low beam headlamp (E1e8) does not function.	Fuse (N7-1 F8), models 208, 210 Fuse (F1f34), model 202 Wiring, Illumination control module (N7-1), Xenon headlamp (D2R, 35W) <sup>2)</sup> , Xenon headlamp control module (E1n1) with Xenon headlamp ignition module (E1n2)	Models 208, 210 23 ⇒ 1.0,  Model 202 23 ⇒ 3.0,
Right Xenon low beam headlamp (E2e8) does not function.	Fuse (N7-1 F6), models 208, 210 Fuse (F1f33), model 202 Wiring, Illumination control module (N7-1) Xenon headlamp (D2R, 35W) <sup>2)</sup> Xenon headlamp control module (E2n1) with Xenon headlamp ignition module (E2n2)	Models 208, 210 23 ⇒ 2.0  Model 202 23 ⇒ 4.0,

1) Observe Preparation for Test, see 22.

2) To prevent damage to new installed Xenon lamps (D2R, 35W), be certain to check system wattage output prior to lamp installation.