## **1.3 Headlamp Range Adjustment (HRA)**

## **Diagnosis – Complaint Related Diagnostic Chart**

Complaint/Problem	Possible cause	Test step/Remedy 1)
Headlamp range adjustment does not function.	Model 129 without ADS and model 140 Rear axle sensor (A51) (headlamp range adjustment) Front axle sensor (A52) (headlamp range adjustment) Model 129 with ADS Front axle level sensor (B22/2) Rear axle level sensor (B22/3) Wiring Headlamp range adjustment motor (E1m1) Headlamp range adjustment motor (E2m1) Headlamp range adjustment control module (N71)	Test with HHT
Headlamprange adjustment can not be tested using the HHT: – No communication between HHT and headlamp range adjustment control module (N71).	Wiring Voltage supply	23 ⇒ 1.0

<sup>1)</sup> Observe Preparation for Test, see 22.