## **Diagnosis – Complaint Related Diagnostic Chart**

Complaint/Problem	Possible cause	Test step/Remedy 1)
Complete mirror and steering column adjustment does not function	Combination control module (N10-1)	23 ⇒ 2.0
Driver-side outside rearview mirror adjustment does not function	Combination control module (N10-1) Outside rearview mirror vertical/horizontal/left/right adjustment (S21s6/s7/s8) Electrically adjustable and heated driver-side outside rearview mirror (M21/5)	$23 \Rightarrow 5.0, 6.0, 9.0$ $23 \Rightarrow 3.0$ $23 \Rightarrow 12.0 - 14.0$
Front passenger outside rearview mirror adjustment does not function	Combination control module (N10-1) Outside rearview mirror vertical/horizontal/left/right adjustment (S21s6/s7/s8) Electrically adjustable and heated front pasenger outside rearview mirror (M21/4)	$23 \Rightarrow 10.0, 11.0, 14.0$ $23 \Rightarrow 4.0$ $23 \Rightarrow 7.0 - 9.0$
Driver-side outside rearview mirror heating does not function	Driver-side outside rearview mirror, voltage supply	23 ⇒ 15.0
Front passenger outside rearview mirror heating does not function	Front passenger outside rearview mirror, voltage supply	23 ⇒ 16.0
Steering column adjustment does not function	Steering column up/down/in/out switch (S91s11, S91s12) Combination control module (N10-1) ESC motor group (M20) CAN H/CAN L data line open circuit or short circuit	$23 \Rightarrow 17.0,$ $23 \Rightarrow 18.0, 19.0,$ D.M., Body and Accessories, Volume 2, 5.2, $23 \Rightarrow 21.0 -$ 25.0

<sup>1)</sup> Observe Preparation for Test, see 22.

## **Diagnosis – Complaint Related Diagnostic Chart**

Complaint/Problem	Possible cause	Test step/Remedy 1)
<b>Memory</b> for mirror and steering column adjustment does not function	Voltage supply for combination control module (N10-1) Left front ESA switch group (S91) Driver-side outside rearview mirror potentiometer Front passenger outside rearview mirror potentiometer Steering column potentiometer Combination control module (N10-1)	$23 \Rightarrow 2.0$ D.M., Body and Accessories Volume 4, 15.3, $23 \Rightarrow 2.0$ $23 \Rightarrow 9.0$ $23 \Rightarrow 14.0$ $23 \Rightarrow 18.0, 19.0$ N10-1
Automatic dimming for interior rearview mirror does not function	RCL receiver (interior rearview mirror (A26/7) Voltage supply for automatic dimming feature	23 ⇒ 20.0

<sup>1)</sup> Observe Preparation for Test, see 22.