

### Diagnosis - Complaint Related Diagnostic Chart (right seat)

Complaint/Problem	Possible cause	Test step/Remedy <sup>1)</sup>
Entire seat adjustment does not function.	Right front power seat control module (N32/2) Right front power seat switch group (S92)	28 ⇒ 1.0 28 ⇒ 18.0, 23.0
Forward/back seat adjustment does not function.	Fore/aft switch (S92s1) Fore/aft motor (M28m1)	28 ⇒ 2.0 28 ⇒ 3.0, 4.0
Front seat height adjustment does not function.	Front raise/lower switch (S92s3) Front raise/lower motor (M28m3)	28 ⇒ 5.0 28 ⇒ 6.0, 7.0
Rear seat height adjustment does not function.	Rear raise/lower switch (S92s2) Rear raise/lower motor (M28m2)	28 ⇒ 8.0 28 ⇒ 9.0, 10.0
Backrest forward/back adjustment does not function.	Backrest fore/aft switch (S92s5) Backrest fore/aft motor (M28m5)	28 ⇒ 11.0 28 ⇒ 12.0, 13.0
Head rest up/down adjustment does not function.	Head restraint raise/lower switch (S92s4) Head restraint raise/lower motor (M28m4)	28 ⇒ 14.0 28 ⇒ 15.0, 16.0
Position memory does not function.	Right front power seat switch group (S92), memory position Right front power seat switch group (S92)	28 ⇒ 17.0 28 ⇒ 18.0, 23.0

<sup>1)</sup> Observe Preparation for Test, see 26.

### Diagnosis - Complaint Related Diagnostic Chart (right seat)

Complaint/Problem	Possible cause	Test step/Remedy <sup>1)</sup>
Convenience feature does not function or some functions fail.	Right seat proximity control module (N32/6)	28 ⇒ 19.0, 20.0
Switch illumination does not function.	Right front power seat switch group Illumination, (S92e1), illumination	28 ⇒ 21.0
Acoustical warning signal sounds if the door is closed and ignition is turned on.	Backrest is not correctly locked. Left/right backrest lock switch (S52/3, S52/4) Left backrest lock safety package (N32/8)	28 ⇒ 22.0 28 ⇒ 24.0, 25.0
Backrest lock safety package/automatic locking feature does not function.	Left/right backrest lock switch (S52/3, S52/4) Right backrest lock safety package (N32/8)	28 ⇒ 22.0 28 ⇒ 24.0, 25.0
Unlocked backrest is not indicated by an optical warning signal, although an acoustical warning signal sounds.	Seat/backrest lock reminder lamp (A1e9)	28 ⇒ 26.0
Optical warning signal comes on constantly with the engine running, although the left and right backrests are locked.	Left/right backrest lock safety package (N32/7, N32/8) (no acoustical warning signal)	28 ⇒ 27.0
Unlocked backrest is not indicated by an acoustical warning signal.	Left/right backrest lock safety package (N32/7, N32/8) (no acoustical warning signal)	28 ⇒ 27.0

<sup>1)</sup> Observe Preparation for Test, see 26.