12/1

## **Diagnosis - Complaint Related Diagnostic Chart**

	I	1	
Complaint/Problem	Possible cause	Test step/Remedy 1)	
Rear power seat adjustment does not function	Convenience relay module (K24)	DM Body & Accessories Vol. 1 section 5.1	
	Rear power seat adjustment switch group(S55/1 or S55/2)	Left seat 23 ⇒ 1.0	Right seat 23 ⇒ 13.0
Rear power seat cushion inclination raise/lower adjustment does not function	Rear power seat adjustment switch group(S55/1 or S55/2) Rear seat motor group,cushion inclination raise/lower motor (M18/1m2 or M18/2m2)	Left seat $23 \Rightarrow 1.0$ $23 \Rightarrow 2.0$ , $3.0$	Right seat 23 ⇒ 13.0 23 ⇒ 14.0, 15.0
Rear power seat backrest fore/aft adjustment does not function  Note: At a specific backrest inclination the seat cushion will not adjust fore/aft	Rear power seat adjustment switch group(S55/1 or S55/2) Rear seat motor group, backrest fore/aft motor (M18/1m2 or M18/2m2)  Rear seat motor group, seat cushion fore/aft motor (M18/1m2 or M18/2m2)	Left seat $23 \Rightarrow 1.0$ $23 \Rightarrow 4.0,$ $5.0$ $23 \Rightarrow 6.0$	Right seat 23 $\Rightarrow$ 13.0 23 $\Rightarrow$ 16.0, 17.0 23 $\Rightarrow$ 18.0
Rear power seat head restraint raise/lower adjustment does not function	Rear power seat adjustment switch group(S55/1 or S55/2) Rear power seat adjustment , head restraint raise/lower switch (S55/1s2 or S55/2s2) Rear seat motor group, seat cushion fore/aft motor (M18/1m2 or M18/2m2)	Left seat $23 \Rightarrow 1.0$ $23 \Rightarrow 7.0$ $23 \Rightarrow 9.0$ , $10.0$	Right seat $23 \Rightarrow 13.0$ $23 \Rightarrow 9.0$ $23 \Rightarrow 20.0$ , $21.0$

<sup>1)</sup> Observe Preparation for Test, see 22.

Diagnostic Manual • Body and Accessories • 11/93

## **Diagnosis - Complaint Related Diagnostic Chart**

Complaint/Problem	Possible cause	Test step/Remedy 1)	
Rear power seat head restraint raise/lower adjustment switch does not function Console switch (S52/5)	Rear head restraint raise/lower switch (S52/5)  Rear head restraint control module (N32/12)  Rear seat motor group, head restraint raise/lower motor (M18/1m3 or M18/2m3)	Left seat $23 \Rightarrow 24.0,$ $25.0$ $23 \Rightarrow 8.0$ $23 \Rightarrow 10.0$	Right seat $23 \Rightarrow 24.0,$ $25.0$ $23 \Rightarrow 8.0$ $23 \Rightarrow 21.0$
Rear power seat adjustment switch group illumination does not function	Rear power seat adjustment switch group (S55/1 or S55/2), or switch group illumination (e1)	Left seat 23 ⇒ 11.0, 12.0	Right seat 23 ⇒ 22.0, 23.0
Rear power seat head restraint raise/lower adjustment switch illumination does not function	Rear head restraint raise/lower switch (S52/5)	23 ⇒ 26.0, 27.0	

Observe Preparation for Test, see 22.