19.3 Roll bar (Crash Deployment)

Diagnosis – Complaint Related Diagnostic Chart

Complaint/Problem	Possible cause	Test step/Remedy 1)
No. 1 RB MIL (A1e29) in instrument cluster does not go out after starting engine (terminal 61) or illuminates while driving.	Determine and localize fault via DTC memory.	12 Terminal 61 loose.
No. 2 Roll bar will not manually retract after crash deployment	RB switch (S83) (manual operation) pressed less then 5 seconds (RB deployment solenoid [Y57/1] clutch not latched). RB deployment solenoid (Y57/1) defective.	12

Observe Preparation for Test, see 22.